Avolites Ltd. Engineering Change Notice

Title	ART2000 I2C bus pull up
ECN Number	ECN-141
Equipment	All ART2000 control cards build prior to 18-10-2001
Author	J.B.Toby
Drawing Number	
Date	18-10-2001

Reason for ECN	Occasional I2C bus corruption during star up and thus bays
	detected
Special Parts required	2x 4K7 0.25W resistors/ solder
Special Tools required	Soldering iron PZ03 screwdriver

Work Required

- 1. Turn of and power down the ART2000 system
- Unscrew the two Pozi screws holding the control card and remove it
 Fit the two resistors in the C9 and C10 locations (just above the STC 7060A text).
- 4. Replace the control card and test the dimming system.

This concludes this ECN

