Avolites Ltd. Engineering Change Notice


Title ART 4000 main card fixing
ECN Number ECN-0118
Equipment All ART 4000 modules until units with production date later
Than May 2000
Author J.B.Toby
Drawing Number
Date 9th May 2000

Reason for ECN	The main card can work itself out of the ribbon connectors during transport This may result in poorly starting of the ART 4000
Special Parts required Special Tools required	after being moved. Rubber foam strip set 32-02-9000 (1 set for 1 module) None

Work Required

Isolate dimmer system from the mains supply;

Slide the dimmer out of the rack until the slides lock
Remove the front top cover using a size 2 supa drive screwdriver.
place the 2 foam strips on the card as per picture below.
do not forget to remove the peel strip

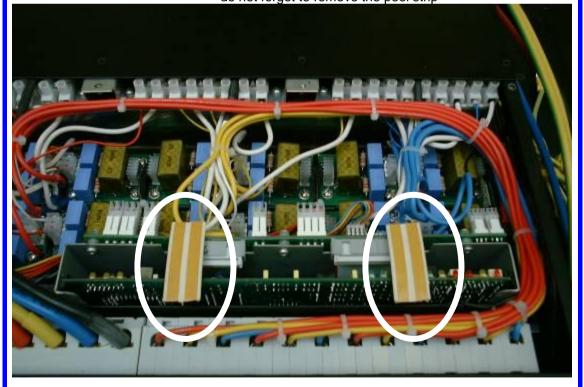

replace the cover at the breaker side first, and rotate the cover down

Avolites Ltd. Engineering Change Notice



Check that both strips have "stuck" to the cover before finally fixing the cover to the dimmer.



This concludes this ECN