



Avolites Ltd
 184 Park Avenue
 London
 NW10 7XL
 England

Switchboard +44 (0) 208 965 8522
 Sales Direct +44 (0) 208 955 9220
 Service Direct +44 (0) 208 955 9230
 Support Direct +44 (0) 208 965 8522
 Fax +44 (0) 208 965 0290

Circuit Board Modification – Encoder Filter

Overview: Spurious glitches output by the Bourns encoder (08-03-0250) require additional filters to be added. Affected encoders have a date code of 2144 and later.

Components: 6 x Capacitor – 10nF 06-03-0200 (603)
 3 x Resistor – 10k 06-01-2325 (603)

Product(s):	Tiger Touch II TT2-PP 1201-7370BA
Existing Circuit:	
Circuit Replacement Location:	<p>Encoder A: 10nF Capacitor replacement at location R26. Add 10nF Capacitor to location R20. 10k Resistor replacement at location C26, C27.</p> <p>Encoder B: 10nF Capacitor replacement at location R23. Add 10nF Capacitor to location R33. 10k Resistor replacement at location C33 and C34.</p>



