


Avolites Ltd.

Engineering Change Notice

Title	A2K tray connector change
ECN Number	ECN-0120
Equipment	ART2000 trays made during early part of 2000 Which have Clear Zink finish instead of non pacifated galvanised finish (gold)
Author	JB Toby
Drawing Number	none
Date	22/05/00

Reason for ECN	Different connector supplied by manufacturer , which has shorter pins
Special Parts required	1322-0050AA D-type spacer
Special Tools required	

Work Required

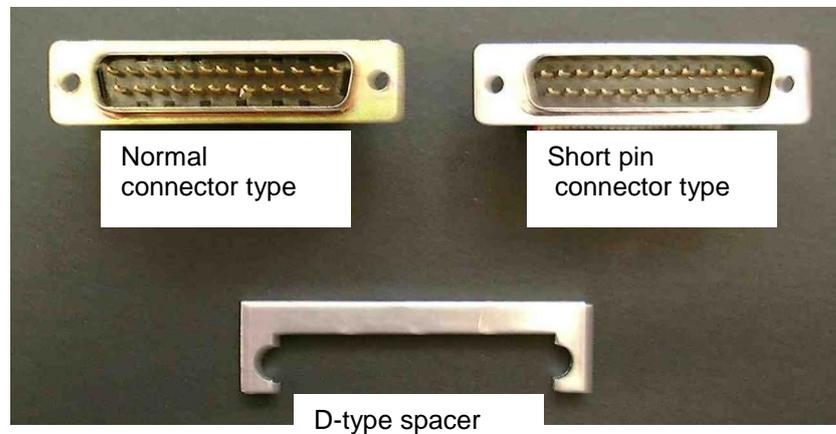

- Remove M3 screw and nyloc nut on right side of the D-type connector .
- Loosen left side M3 screw and nyloc nut by 2 mm
- Carefully pull the connector of the tray and insert spacer between connector and tray
- Insert right side M3 screw and nyloc nut
- While keeping the connector centred tighten both screws.
- Refit tray in the dimmer and test
- This concludes this ECN