


Avolites LTD Engineering Change Notice

ECN title	QTZ LEDs remain on		
ECN Number	ECN-0216		
Related Product(s)	QTZ		
Date / Author	14/11/2022	GK	
Reasons for ECN	When console powers down, the fader LEDs remain on		
Parts required	06-03-0264 - CAP. SMD 10uF, MLCC 1206		
Tools required	PZ2 driver, Solder iron		
Estimated time	10 minutes		

Important information


We have had a case of when console powers down, the fader LEDs remain on.

1. Capacitor replacing

Open the console.

Support the Front Panel.

Replace existing C23 capacitor with the supplied one (06-03-0264 - CAP. SMD 10uF, MLCC 1206)

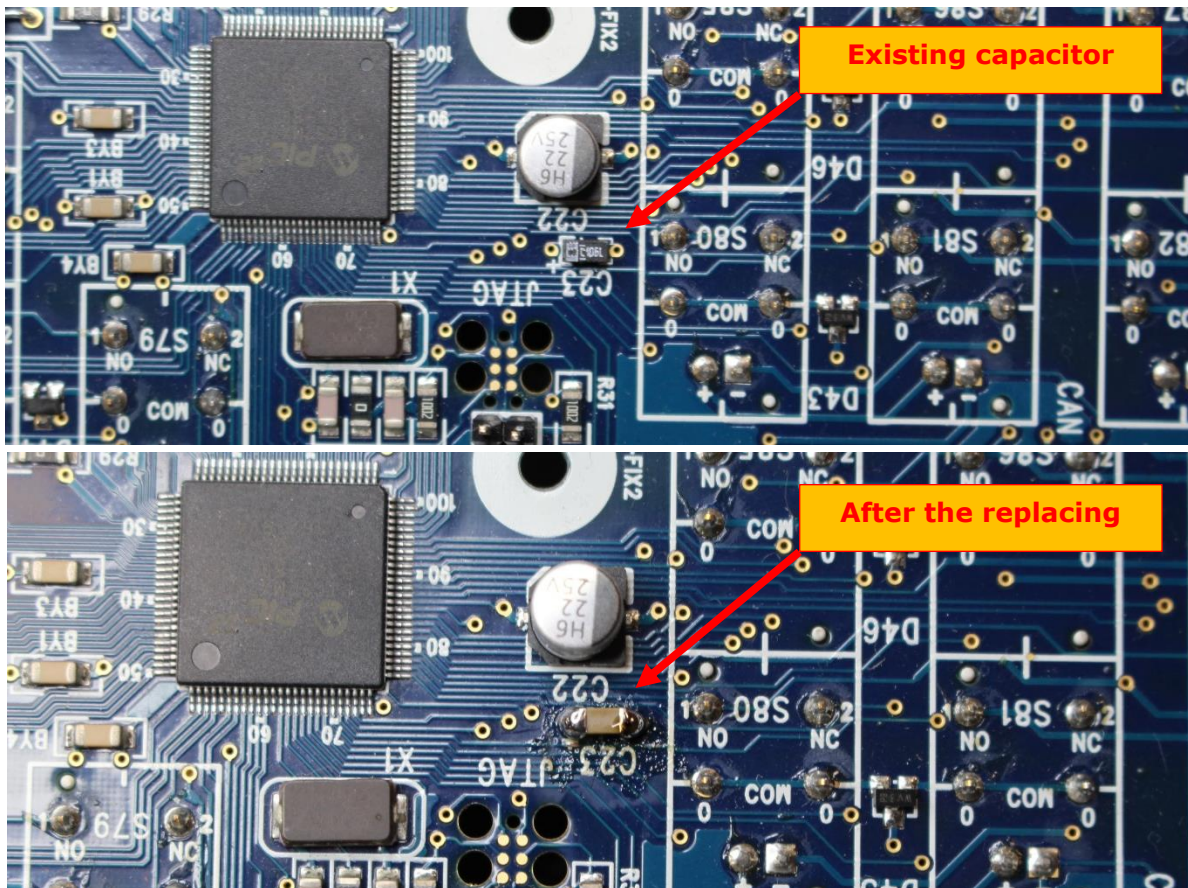

Lower the Front Panel Support then close the unit with the retained screws.